

Instructions

Instructions

Congratulations for buying your Desktop housing AZ/EL Alu for ERC-M. This document will guide you through the needed steps for assembly of the Desktophousing and integration of the ERC-M. You will reach the best result by following these instructions step by step.

Table of contents

Safety-Instructions	2
1. Description	
2. Bill of material (BOM)	
3. Assembly bottom-side of PCB	
4. Assembly top-side of PCB	
5. Cable to connect the HID to ERC-M	
6. Cable to connect the ERC-M to rear-side D-SUB	8
7. Mechanical integration into the desktop-housing	
Appendix	
Appendix 1: Pin-out of D-SUB15 ERC-M	
Appendix 2: Schematics HID	

web : www.schmidt-alba.de email : erc@schmidt-alba.de



Instructions

Safety-Instructions



- Don't continue using the product if it is damaged.
- Keep electronic assemblies and components away from children!
- Products that carry electric voltages must be handled by taking care about the valid instructions and regulations.
- If the product must be repaired, only use original spare parts! Using different parts
 may cause property damage and personal injury! The repair has only to be done
 by an expert!
- The installation has to be done by a skilled expert.
- Connection-cables have to be chosen according to the needed diameter.
- Before working on the product all supply-voltages have to be securely cut of.
- The product is designed to work in clean and dry areas inside buildings.
- Prevent the product of humidity, water and heat.
- Don't use the product in areas where explosive gases, vapour or dust are or may occur.
- Don't let the product fall or apply mechanical stress as the product may be damaged.



Instructions

1. Description

The HID is a **h**uman-interface-**d**evice and provides a 2x16 character LCD-display, 6 LEDs and 4 pushbuttons to the user. The HID and ERC-M is mounted in a laser-marked aluminium desktophousing.

2. Bill of material (BOM)

The BOM is in the order how you should use the parts.

HID V2.0 + Desktop housing AZ/EL Alu Bill Of Material						
TY	Туре	Value	Reference	Comments		
sse	mbly of bottom-side o	f PCB				
1	PCB	HID 2-layer 119.8x36.6mm V2.0				
4	Diode	1N4004	D1,D2,D3,D4	Alt. 1N4148		
6	Resistor	300R 5%	R2,R3,R4,R5,R6,R7	Alt. 300R 1%		
1	Resistor	54R 5%	R8	Alt. 53.6R 1% or 51R 5%		
1	Potentiometer	10KA	R1			
1	Box-header	2x8 pole	X2			
sse	mbly of top-side of PC	В				
4	Switch	3FTL6	S5,S6,S7,S8			
4	LED	green 3mm LC	LED5,LED6,LED7,LED8			
2	LED	yellow 3mm LC	LED9,LED10			
6	Spacer	3x12x4mm	for LEDs			
1	LCD	with backlight	DIS1			
1	Pinheader	1x16 pole		for LCD		
4	Spacer	2.5x5x5mm		LCD-mounting		
4	Screw	M2.5x12mm		LCD-mounting		
4	Nut	M2.5		LCD-mounting		
4	Dome	19mm		for switches		
4	Distance-bolt	M3x35mm		HID-mounting		
8	Screw	M3x6		PCB- and HID-mounting		
able	eing					
1	Flat ribbon cable	330mm 16 pol.		for cables		
2	Connector	2x8 pole		for HID to ERC-M cable		
1	DSUB-connector	15 pole male flat ribbon		for D-SUB-cable		
1	DSUB-connector	15 pole female flat ribbon		for D-SUB-cable		
ech	anical integration					
1	Housing	Aluminium AZ/EL		bottom and cover		
4	Glue-feet	d=12mm		housing		
8	Screw	M3x4mm countersunk		housing and HID-mountin		
2	Distance-bolt	UNC4 5mm		for D-SUB		
1	Blind cap	LAN		LAN-hole if LAN not used		



Instructions



3. Assembly bottom-side of PCB

Assemble and solder the components according to the following drawings.

Please read the following instructions before you start:

Take care of polarization of the following components:

- Diodes D1,D2,D3,D4
- Box-header X2


Those components are marked red in the following drawing.


Carefully compare the position of the PCB with the drawings before you start to assemble it.

Components:


Colour-code of Resistors:

54R 5% green-yellow-black-gold alt.: 53.6R 1% green-orange-blue-gold-brown alt. 51R 5% green-brown-black-gold 300R 5% orange-black-brown-gold alt.: 300R 1% orange-black-black-brown

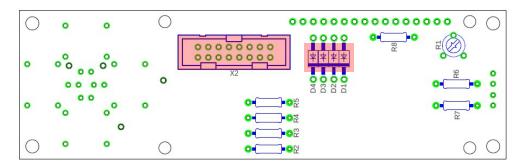

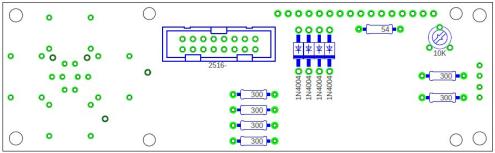

This is how it should look like:

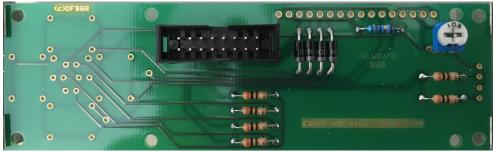

Inspect carefully the assembly and soldering. Once the LCD is mounted (next step), it becomes quite difficult to rework any soldering or assembly of the bottom-side!



© Ing.-Büro E. Alba de Schmidt Gartenstr. 21

Page 4 of 13 20240514

86703 Rögling / Germany

 


4. Assembly top-side of PCB

Assemble and solder the components according to the following drawings.

Please read the following instructions before you proceed:

LEDs:




Take care of polarization of the following components:

LED1,LED2,LED3,LED4,LED9,LED10


Those components are marked red in the following drawing.

Assemble and solder the switches and LEDs according to the following drawings.

Use the 3x12x4mm spacers for the LEDs to fix them in the right distance from the PCB. Take care that the switches fit plane to the PCB. Otherwise you will have problems with sticky switches later when the HID is mounted to the front-panel.

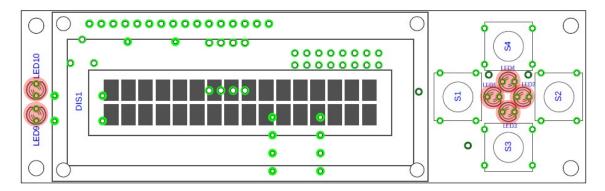


Hint: Only solder 1 leg of the switches and LEDs, check for alignment and than solder the remaining pins.

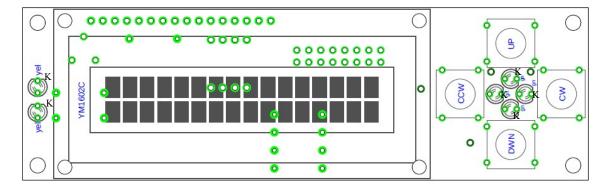

Put the 19mm domes on top of the switches.

86703 Rögling / Germany

This is how it should look like:

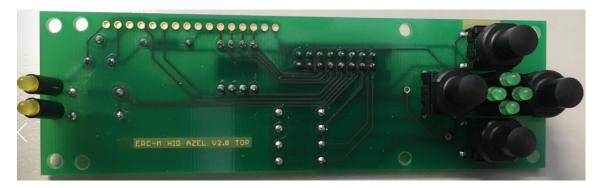

Assemble the LCD with the 5mm spacers, screws, nuts to the PCB. Put the 16-pole pin-header between PCB and LCD before mounting. Leave the protection-foil on the LCD until the HID will be mounted into the housing.

Now solder the 16-pole pin-header first to the LCD and than to the PCB. This is how it should look like:




Mount the 4 distance-bolts M3x15 with 4 screws M3x6 on the PCB.



web: www.schmidt-alba.de

5. Cable to connect the HID to ERC-M

Cut 130mm from the flat-ribbon-cable and press the 2x8 pole connectors to both ends as shown in the next picture.

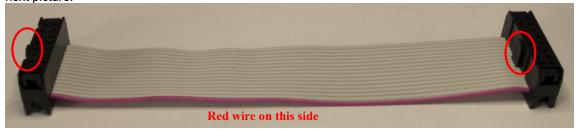


Take care of the orientation of the connectors (red circle) and the position of the red wire.

Use a bench-vise to properly press the connectors to the flat-ribbon-cable. Those connectors are quite sensible and may damage if you don't press them properly.



Bend the flat-ribbon-cable on both ends over the top of the connector and put the strain-relief on.

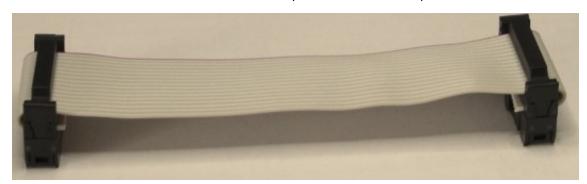



Instructions

6. Cable to connect the ERC-M to rear-side D-SUB

Take the remaining 200mm of the flat-ribbon-cable and remove 1 wire from the 16-pole cable to get a 15-pole cable (don't remove the red wire, take the opposite site)

Press the 2 DSUB-connectors to both ends as shown in the next picture. The red wire always has to show to pin 1 of the connectors. The pin-number of the connectors is printed in the plastics of the connectors.



Red wire on this side

web: www.schmidt-alba.de email: erc@schmidt-alba.de

7. Mechanical integration into the desktop-housing

Mount the 4 glue-feet to the desktop housing. (clean the gluing-areas before)



Remove the protection-foil from the LCD and mount the HID into the desktop-housing with 4 countersunkscrews M3x4.



Mount the ERC-M-PCB to the housing with 4 screws M3x6.



Fold the 15-pole flat-ribbon-cable as shown and put the DSUB-connectors as shown and mount the female-DSUB-connector to the back-panel of the housing with the 2 UNC4 5mm distance-bolts.



© Ing.-Büro E. Alba de Schmidt Gartenstr. 21 86703 Rögling / Germany


Page 9 of 13 20240514

web: www.schmidt-alba.de email: erc@schmidt-alba.de

Attach the 16-pole flat-ribbon-cable into the connectors as shown.



Connect the ERC-M to DC-supply or USB to adjust contrast settings.

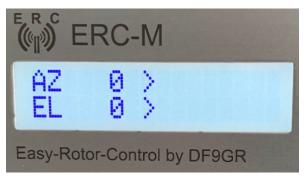


Adjust the contrast with the potentiometer R1 on the backside of the HID-PCB.



Put the top-cover onto the housing and fix it with 4 countersunk-screws M3x4mm



 If you don't use the LAN-Option of the ERC-M, you can covert he the hole with the blind cap. Therefore cut the lamellas on one side of the cap with a knife and press the cap into the back-panel of the housing.












Appendix

Appendix 1: Pin-out of D-SUB15 ERC-M

Connector seen from outside to the female connector on the back of the desktop-housing.

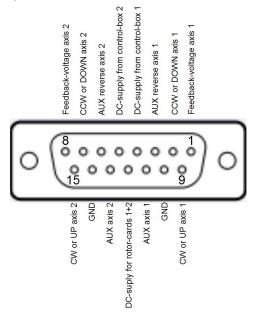

web: www.schmidt-alba.de

email: erc@schmidt-alba.de



Instructions

Appendix 2: Schematics HID

